



# SERVICE BULLETIN

Feb. 15, 2000

SEGA Service Department  
45133 Industrial Drive  
Fremont, Ca. 94538

<http://www.seusevice.com>  
Phone: 415.701.6580  
Fax: 415.701.6594




**FOR ALL BASS  
FISHING U/R  
GAMES**

**Problem:** Reel encoder becomes disfunctional.

**Cause:** Excessive static being discharged into control handle can damage encoder.

**Solution:** To help control this, a second ground wire (18 guage) can be added to the handle assy (see diagram below) . Also, the use of an extension cord for main power should be avoided. The outlet that the machine is plugged into needs to be properly grounded, use Recepticle (plug polarity) Tester to verify. (Grainger Part No. 3T885) *or equivalent.*

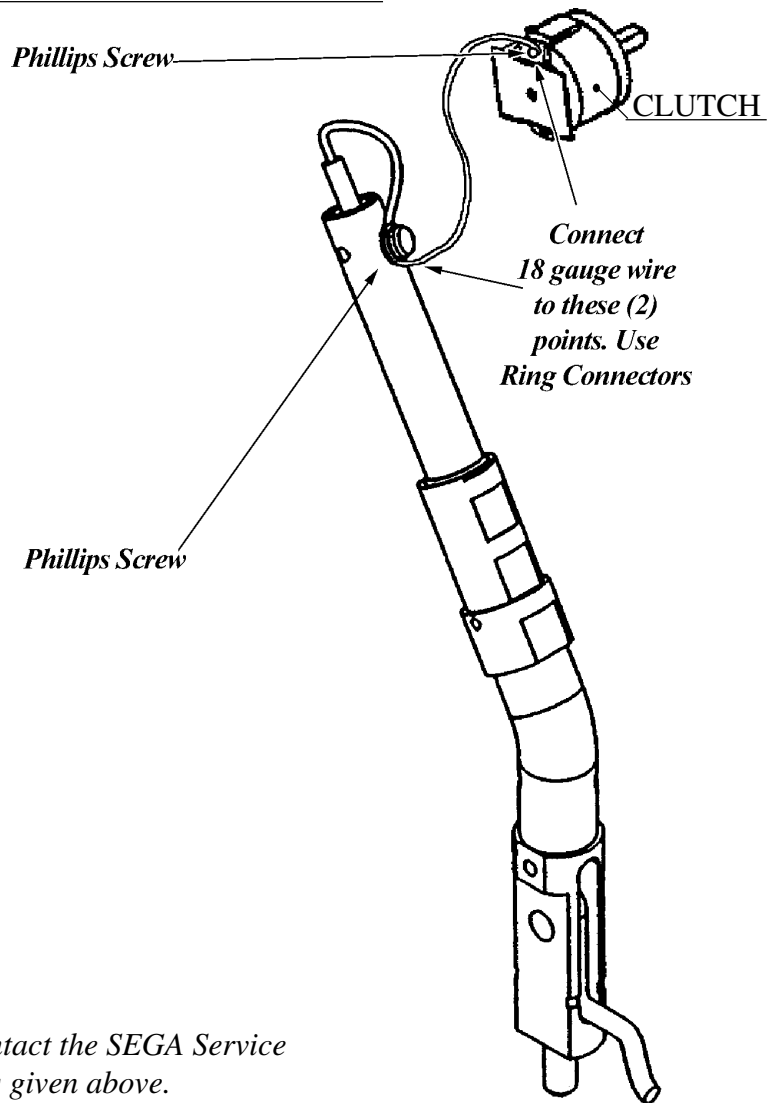

*If you have any questions please contact the SEGA Service Department at the numbers given above.*